Monitoring Relays
3-Phase Load Guard
Types DWA01, PWA01


DWA01


PWA01

- **Cos φ monitoring relays**
- **Measuring if power factor is within set limits**
- **Measure their own power supply (voltage) and current for balanced systems**
- **Measuring ranges for current: 5A and MI current transformers range**
- **Power ON delay 1, 2 or 6 s selectable**
- **Knob adjustable level on absolute scale**
- **Output: 8 A SPDT relay Normally Energized**
- **For mounting on DIN-rail in accordance with DIN/EN 50 022 (DWA01) or plug-in module (PWA01)**
- **22.5 mm Euronorm housing (DWA01) or 36 mm plug-in module (PWA01)**
- **LED indication for power supply and output ON**

Product Description

DWA01 and PWA01 are precise over or under cos φ monitoring relays.
The relays monitor their own power supply voltage and the current of a balanced 3-phase system.
For current measure direct connection, 5A standard current transformers and MI CT can be used.
The LED's indicate the state of the alarm and the output relay.

Ordering key

DWA 01 C M48 5A

- **Housing**
- **Function**
- **Type**
- **Item number**
- **Output**
- **Power Supply**
- **Range**

Type Selection

Mounting	Output	Supply: 208 to 240 VAC	Supply: 380 to 415 VAC	Supply: 380 to 480 VAC
DIN-rail	SPDT	**DWA 01 C M23 5A**		**DWA 01 C M48 5A**
Plug-in	SPDT	**PWA 01 C M23 5A**	**PWA 01 C M48 5A**	

Input Specifications

Input

Voltage (Own power supply):		
3 - phase	DWA01:	L1, L2, L3
	PWA01:	5, 6, 7
	M23:	208 to 240 VAC ± 15%
	DWA01CM48:	380 to 480 VAC ± 15%
	PWA01CM48:	380 to 415 VAC ± 15%
1- phase	DWA01CM235A:	L1, L3
	PWA01CM235A:	5, 7
		208 to 240 VAC ± 15%
Current	DWA01:	5A: L1, I2 MI CT: U1, U3
	PWA01:	5A: 9, 10 MI CT: 8, 11

Measuring ranges

	Level	
Power factor (cos φ)	0.1 to 0.99	
	AACrms	**Max. curr.**
Direct input	0.5 to 5 A	30A 30s
Standard CT (examples)		
TADK 2 50 A/5 A	5 to 50 A	60 A
CTD1 150 A/5 A	15 to 150 A	180 A
CTD4 400 A/5 A	40 to 400 A	480 A
TAD12 1000 A/5 A	100 to 1000 A	1200 A
TACO200 6000 A/5 A	600 to 6000 A	7200 A
MI CT ranges		
MI 100	10 to 100 A	250 AAC
MI 500	50 to 500 A	750 AAC

Note:
The input voltage cannot raise over 300 VAC with respect to ground (PWA01 only).

Hysteresis ~ cos φ = 0,02 - fixed

Output Specifications

Output		SPDT relay
Rated insulation voltage		250 VAC
Contact ratings ($AgSnO_2$)		μ
Resistive loads	AC 1	8 A @ 250 VAC
	DC 12	5 A @ 24 VDC
Small inductive loads	AC 15	2.5 A @ 250 VAC
	DC 13	2.5 A @ 24 VDC
Mechanical life		≥ 30 x 10^6 operations
Electrical life		≥ 10^5 operations (at 8 A, 250 V, cos φ = 1)
Operating frequency		≤ 7200 operations/h
Dielectric strength		
Dielectric voltage		≥ 2 kVAC (rms)
Rated impulse withstand volt.		4 kV (1.2/50 μs)

Supply Specifications

Power supply		Overvoltage cat. III (IEC 60664, IEC 60038)
Rated operational voltage through terminals:		
	DWA01:	L1, L2, L3
	PWA01:	5, 6, 7
	M23	177 to 276 VAC 45 to 65 Hz
	DWA01CM48	323 to 552 VAC 45 to 65 Hz
	PWA01CM48	323 to 477 VAC 45 to 65 Hz
Dielectric voltage		None
supply to output		2kV
Rated operational power		13 VA @400VAC Supplied by L1 and L3

General Specifications

Power ON delay		1, 2, or 6 s ± 0.5 s
Reaction time		(input signal variation from -20% to +20% or from +20% to -20% of set value)
Alarm ON delay		< 400 ms
Alarm OFF delay		< 400 ms
Accuracy		(15 min warm-up time)
Temperature drift		± 1000 ppm/°C
Repeatability		± 0.5% on full-scale
Indication for		
Power supply ON		LED, green
Output ON		LED, yellow
Environment		
Degree of protection		IP 20
Pollution degree		3 (DWA01), 2 (PWA01)
Operating temperature		
@ Max. voltage, 50 Hz		-20 to 60°C, R.H. < 95%
@ Max. voltage, 60 Hz		-20 to 50°C, R.H. < 95%
Storage temperature		-30 to 80°C, R.H. < 95%
Housing		
Dimensions	DWA01	22.5 x 80 x 99.5 mm
	PWA01	36 x 80 x 94 mm
Material		PA66 or Noryl
Weight		Approx. 200 g
Screw terminals		
Tightening torque		Max. 0.5 Nm acc. to IEC 60947
Product standard		EN 60255-6
Approvals		UL, CSA
CE Marking		L.V. Directive 2006/95/EC EMC Directive 2004/108/EC
EMC		
Immunity		According to EN 60255-26 According to EN 61000-6-2
Emissions		According to EN 60255-26 According to EN 61000-6-3

Function/Delay/Level Settings

Level setting (cos φ):
Knob adjustable on absolute scale, from 0.1 to 0.99

Setting of function and power ON delay
Adjust the desired function (over or underload monitoring) with DIP switch 1 and the power ON delay with DIP Switches 3 and 4 as shown on the below table. To access the DIP-switch open the plastic cover using a screwdriver as shown on the left.

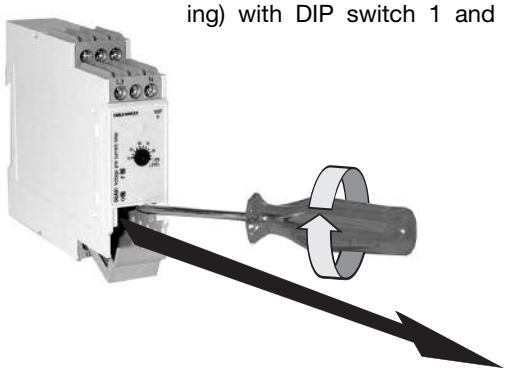

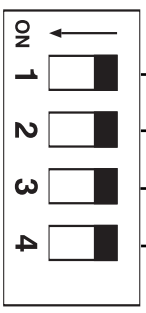

Monitoring function
ON: Under cos φ
OFF: Over cos φ

Not used

Power ON delay

SW3	SW4	
OFF	OFF	6 sec
ON	OFF	2 sec
ON	ON	1 sec

Mode of Operation

DWA01 and PWA01 can be used for monitoring the actual load of asynchronous motors.
The relays measure the 3-phase supply voltage and the current of the phase L1 connected to an asynchronous motor.
The relay monitor the cosine of the angle between motor current and motor voltage (cos φ).
As cos φ varies with the load of the motor, overload (or underload) can be indirectly detected by DWA01 and PWA01.
The relation between the load and cos φ depends on the type of motor.
As a guideline to ensure correct working conditions for a motor, the level could be set above (or below) the cos φ marking on the motor. It is however recommended to make the adjustment in connection with a practical test.
The relay has an inhibit delay at power ON in order to avoid overload detection during motor start.

Example 1:
Overload monitoring.
The relay operates and the yellow LED is ON as long as cos φ is below the set limit.
The relay releases when it exceeds the set level.

Example 2:
Underload monitoring.
The relay operates and the yellow LED is ON as long as cos φ is above the set limit.
The relay releases when it drops below the set level.

Example 3:
DWA01CM235A and PWA01CM235A can be used for monitoring the cos φ of a 1-Phase load with 208 to 240 V AC mains voltgage.
In this case the power supply has to be connected between L1, L3 (or 5, 7) and L2 and L3 (or 6 and 7) have to be connected.

Operation Diagrams

Overload monitoring

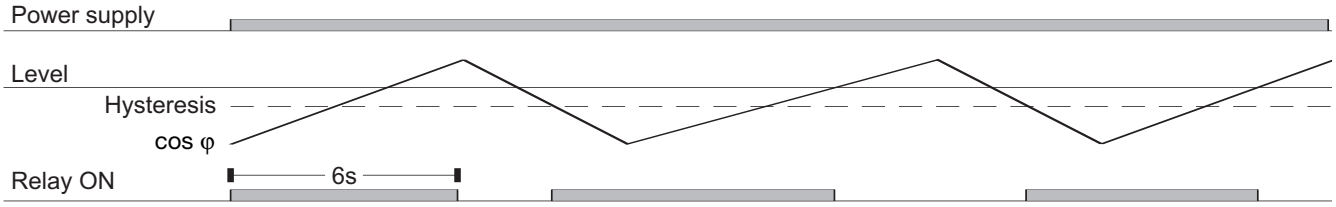

Underload monitoring

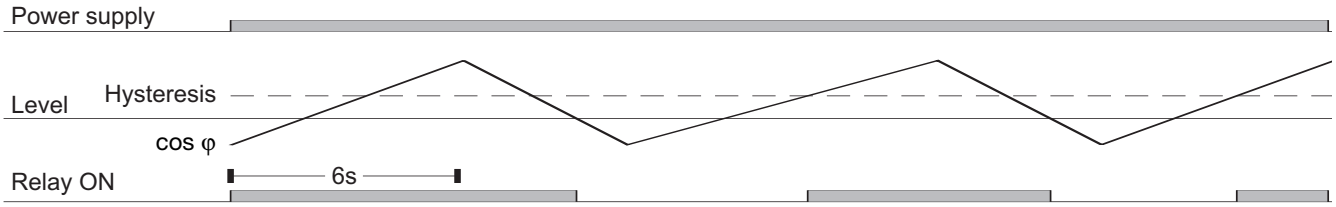

Wiring Diagrams

DWA01 - Direct connection

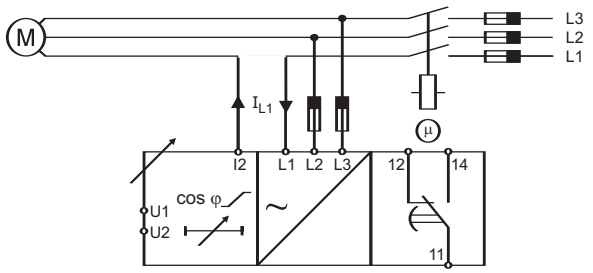

PWA01 - Direct connection

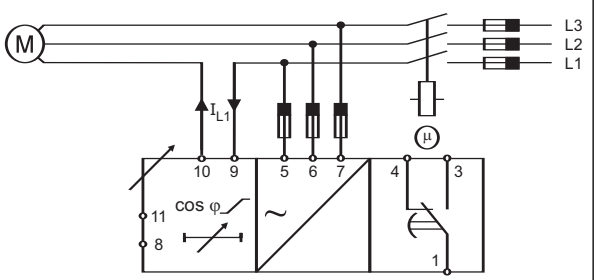

Wiring Diagrams (cont.)

DWA01 - Standard CT

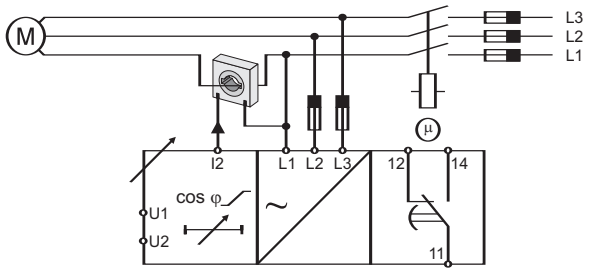

PWA01 - Standard CT

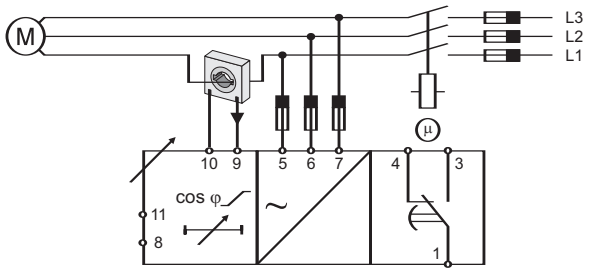

DWA01 - MI CT

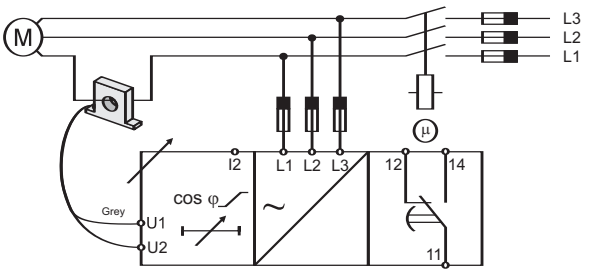

PWA01 - MI CT

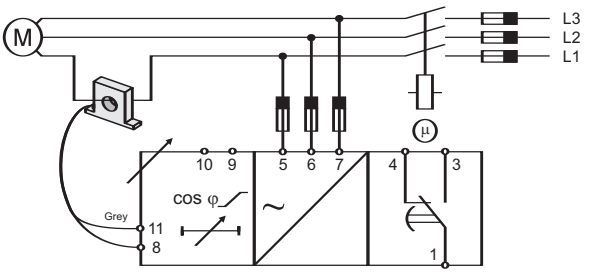

DWA01CM235A - Direct connection - 1-Phase Load

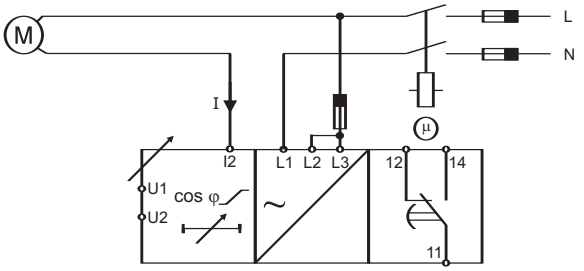

PWA01CM235A - Direct connection - 1-Phase Load

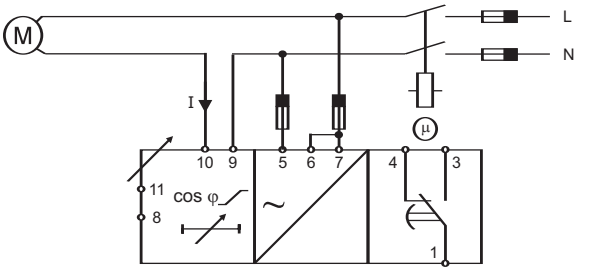

Dimensions

DIN-rail

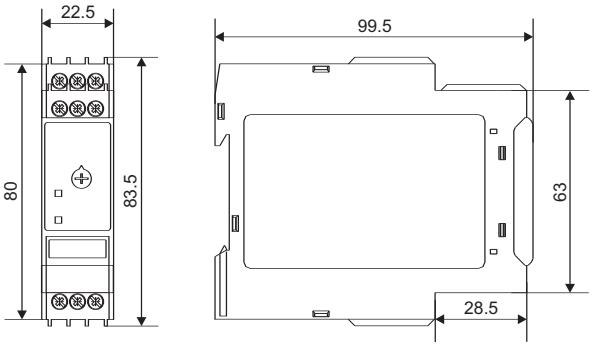

Plug-in