

Raspberry Pi Relay Board v1.0



The Relay Shield utilizes four high quality relays and provides NO/NC interfaces that control the load of high current. Which means it could be a nice solution for controlling devices that couldn't be directly controlled by IIC bus. Standardized shield form factor enables smoothly connection with the Raspberry Pi. The shield also has four dynamic indicators show the on/off state of each relay.

Features

- Raspberry Pi compatible
- Interface: IIC, Three hardware SW1 (1, 2, 3) select the fixed I2C-bus address
- Relay screw terminals
- Standardized shield shape and design
- LED working status indicators for each relay
- COM, NO (Normally Open), and NC (Normally Closed) relay pins for each relay
- High quality relays
- Working status indicators for each relay


Specifications

Item	Min	Typical	Max	Unit
Supply Voltage	4.75	5	5.5	VDC
Working Current	10	/	360	mA
Switching Voltage	/	/	30/250	VDC/VAC
Switching Current	/	/	15	А
Frequency	/	1	/	HZ
Switching Power	/	/	2770VA/240	W
Relay Life	100,000	/	/	Cycle
Dimensions	91.20 * 56.15 * 32			mm

Caution

Place 2 layers of electrical tape on the top of the Arduino's usb connector. This will prevent the relay shield from making contact. Do not operate voltage more than 35V DC.

Hardware Overview

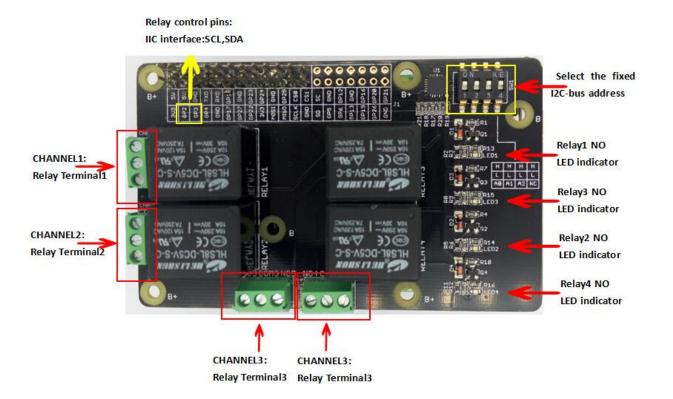

Usage

This section was written by John M. Wargo, here we would like to express our gratitude to John's contribution. We have amended the original text a little to fit it in the whole Seeed's document. Please click here to visit the original document on his website.

The steps for installing the board and verifying that it works includes the following steps:

- Step1. Mount the Relay board on the Raspberry Pi
- Step2. Enable the Raspbian I2C software interface
- Step3. Validate that the Raspberry Pi recognizes the board
- Step4. Run some Python code to exercise the board

Step1. Mounting the Relay Board

Mounting the board is easy, it comes with the appropriate female headers you need to mount it on any Raspberry Pi board with male headers. Note: You'll have to add male headers to the Raspberry Pi Zero to use the board.

We recommend you putting some electrical tape on top of the Raspberry Pi Ethernet port before mounting the board. If you mount the board without using standoffs (as I've done in the example figure below), there's a chance the board will make contact with the Ethernet port housing and cause a problem.




Figure 1

For a production project, We'd definitely recommend using standoffs to hold the two boards in place.

The relay board is configured for an older Raspberry Pi with a 26 pin header, so when you connected it to a Raspberry Pi with 40 pin headers, you'll need to shift it all the way to the side like We've shown in the figure. If you don't align the pins correctly, you'll have problems later as it simply won't work.

Enabling I2C

The relay board communicates with the Raspberry Pi through an I2C interface https://en.wikipedia.org/wiki/I%C2%B2C. This interface is disabled by default in the Pi's Raspbian OS, so you'll have to turn it on before you can use the board. Power up the Pi and let it boot to the graphical interface. When it's up and running, open the Pi menu, select Preferences, then Raspberry Pi Configuration as shown in the following figure:

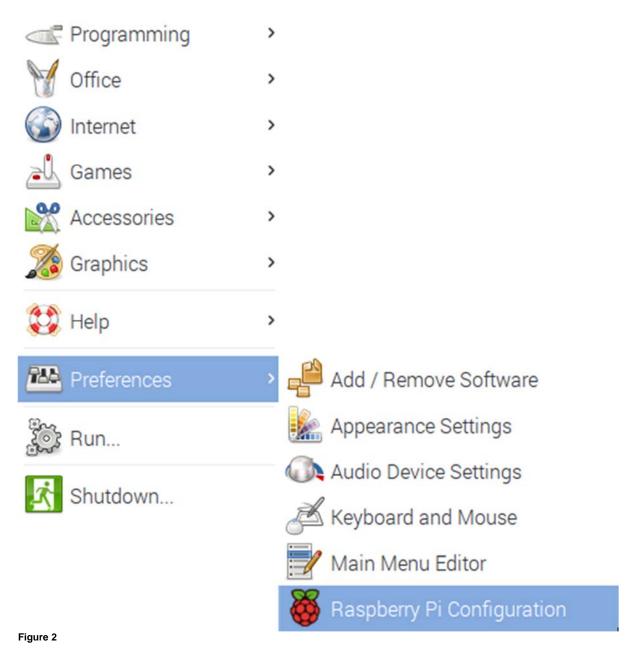

In the window that opens, select the Interfaces tab as shown in the following figure. Enable the option next to I2C as shown in the figure and click the OK button to continue. When you reboot the PC, the Pi should see the relay board. In the next section, we'll verify that the Pi sees the relay board.

Raspberry Pi Configuration 👤 🗖 🗙						
System	Interfaces	Performance	Localisation			
Camera:		Enable	Disable			
SSH:		• Enable	O Disable			
VNC:		O Enable	Disable			
SPI:		O Enable	Disable			
I2C:		• Enable	O Disable			
Serial:		O Enable	e • Disable			
1-Wire:		O Enable O Disable				
Remote GPIO:		○ Enable				
		Ca	ancel OK			

Figure 3

Validating the Raspberry Pi Sees the Relay Board

With the I2C interface enabled, it's time to make sure the Raspberry Pi sees the relay board. Open a terminal window on the Pi and execute the following command:

```
1 i2cdetect -y -r 1
```

The application will display a dump of the recognized I2C devices as shown in the following figure. In this example, there's only one I2C board on the system, the relay board configured at an address of 20. You'll see how this value is important later in this article.

Figure 4

You're supposed to be able to use switches on the relay board to set the I2C address, there are 4 DIP switches on the board, let's see what happens when you change them.

There are four switches, three labeled A0 through A2, and one labeled NC. The NC means No Connection. Each switch has a high and a low setting, so the following table will lay out how to use them to set an I2C address for the board:

A0	A1	A2	Address
High	High	High	20
Low	High	High	21
High	Low	High	22
High	High	Low	24
High	Low	Low	26
Low	Low	Low	27

Running the Test Application

Please use the test code from github repository. Grab the code from there and you'll be able to easily complete the following step.

To run the test application, open a terminal window, navigate to where you've extracted the sample application and run the application using the following command:

```
python ./seeed_relay_test.py
```

Figure 4

When prompted for input, you'll type commands to turn the relays on and off:

- Typing 1on, 2on, 3on, or 4on and pressing enter will cause the specified relay to turn on.
- Typing 1off, 2off, 3off, or 4off and pressing enter will cause the specified relay to turn off
- Typing allon or alloff will turn all relays on or off.

Using The Python Module

To use the module in your own Python applications, copy the module (relay_lib_seed.py) into your project folder, then import the module in your Python application by adding the following line to the beginning of your application:

from relay_lib_seeed import *

This exposes a series of functions to your application:

- relay_on(int_value) Turns a single relay on. Pass an integer value between 1 and 4 (inclusive) to the function to specify the relay you wish to turn on. For example: relay_on(1) will turn the first relay (which is actually relay 0 internally) on.
- relay_off(int_value) Turns a single relay on. Pass an integer value between 1 and 4 (inclusive) to the function to specify the relay you wish to turn on. For example: relay_on(4) will turn the first relay (which is actually relay 3 internally) off.

- relay_all_on() Turns all of the relays on simultaneously.
- relay_all_off() Turns all of the relays off simultaneously.

The module exposes a configuration value you will want to keep in mind as you work with the board:

```
1# 7 bit address (will be left shifted to add the read write bit)
2 DEVICE_ADDRESS = 0x20
```

Remember that value? 20? The board defaults to this address. If you change the switches on the board, you will need to update this variable accordingly.

To see the module in action, open a terminal window on the Raspberry Pi, navigate to the folder where you extracted this repository's files, and execute the following command:

```
1python ./relay_lib_seeed_test.py
```

The application will:

- Turn all of the relays on for a second
- Turn all of the relays off
- Cycle through each of the relays (1 through 4) turning each on for a second

The module will write indicators to the console as it performs each step as shown in the following figure:

```
pi@raspberrypi: ~/dev __ _ X

File Edit Tabs Help

pi@raspberrypi: ~ $ cd dev
pi@raspberrypi: ~/dev $ python ./relay_lib_seeed_test.py

Turning all relays ON

Turning all relays OFF

Turning relay 1 ON

Turning relay 2 OFF

Turning relay 2 OFF

Turning relay 3 ON

Turning relay 3 OFF

Turning relay 4 OFF

Turning relay 4 OFF

Turning relay 4 OFF

Turning relay 1 ON
```

Figure 6

LEDs on the relay board (one for each relay) will illuminate when the relays come one. On my board, they weren't in sequence, so don't expect them to light in order.

The code that does all this looks like the following:

```
1# turn all of the relays on
 2relay_all_on()
 3 # wait a second
 4 time.sleep(1)
 5 # turn all of the relays off
 6relay_all_off()
 7 # wait a second
 8 time.sleep(1)
 9 # now cycle each relay every second in an infinite loop
10 while True:
11 for i in range(1, 5):
12
    relay_on(i)
time.sleep(1)
14
     relay_off(i)
```

That's it, that's all there is to it. Enjoy.

Resources

- Raspberry_Pi_Relay_Board_v1.0_sch_pcb
- Raspberry_Pi_Relay_Board_v1.0_PDF
- HLS8L Datasheet
- PCAL9535A Datasheet
- Python Test Code
- C# Test Code

Tech Support

Please submit any technical issue into our forum or drop mail to techsupport@seeed.cc.